

Manhole Inspection Summary

Manhole # S29I__012MH

Printed On: 3/20/2009

Page 1 of 5

Inspection ☐ Is Incomplete Rating: **4) Poor**

Record Plat: **29I** Node: **012** Status: **Found**

Insp Date: **9/11/08 9:58 AM**

Incomplete Comments

Crew: **WJ,Sk**
Inspector: **wjenkins**
Firm: **PER**

Location Address: **W Pratt**

Cross Street: **MLK**

Manhole Type: **Junction**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover

Shape: **Circular**

Diameter: **25.** (in.) Length: **0** (in.) Dist A/B Grade: **0.25** (in.)
75

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☐ Sound ☐ Cracked ☒ **Leaks**

Chimney / Frame Adjustment

☒ Exists Material: **Brick**

☐ Parged Height: **7** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Loose Brick** ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular** Diameter: **42** (in.) Length: **0** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

Bench

☒ Exists Material: **Brick**

☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps

Count: **9** Missing: **0** ☒ **Corroded**

Surcharge

☒ **Evidence Of Surcharge** Depth: **4** (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S29I__012MH

Printed On: 3/20/2009

Page 2 of 5

Location View



W Pratt and MLK

Top View



Miscellaneous



lid pic

Miscellaneous




Frame View

Defect 5



surcharge

Defect 4

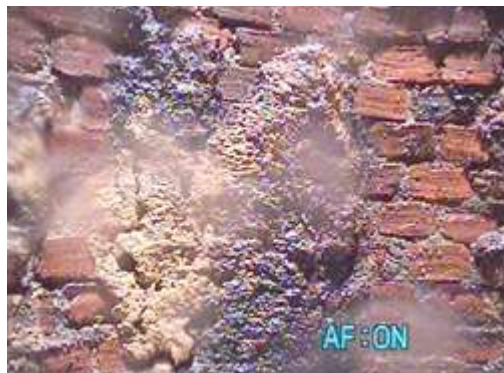

barrel wall infiltration and barrel deteriorated

Defect 3



lid frame infiltration

Defect 2



chimney has loose brick with infiltration coming from gap in joint between chimney and frame

Defect 1



corroded rungs

Manhole Inspection Summary

Manhole # S29I__012MH

Printed On: 3/20/2009

Page 4 of 5

10 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **10.8** (in.) Rod and Bar (Angled)
Pipe Material: **Clay** ☐ Pipe Lined
Invert Depth: **14.80** (ft.) Flow Characteristics: **Fast**
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease
Silt Depth: **0** (in.) Deposits Extent:
Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

10 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow



Pipe Height: **10.8** (in.) Rod and Bar (Angled)
Pipe Material: **Clay** ☐ Pipe Lined
Invert Depth: **10.45** (ft.) Flow Characteristics: **Fast**
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease
Silt Depth: **0** (in.) Deposits Extent:
Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop In @ 6 O'Clock



Drop: **Inside** Rod and Bar
Angled: **Yes** Reading: **13.30** (ft.)
Inv Depth: **14.30** (ft.)
Drop Condition: **Clogged**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S29I__012MH

Printed On: 3/20/2009

Page 5 of 5

12 in. Circular Gravity Sewer
Pipe In @ 8 OClock

8 O'Clock Inflow

Drop In @ 8 OClock



connection obscured by flow from pipe in
connection @ 6 oclock

Pipe Height: 12 (in.) Rod and Bar (Angled)

Pipe Material: Clay ☐ Pipe Lined

Invert Depth: 12.28 (ft.) Flow Characteristics: Slow

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: None Pipe Seal Cond: Unknown

Drop: Inside	Rod and Bar
Angled: Yes	Reading: 13.58 (ft.)
	Inv Depth: 14.58 (ft.)
Drop Condition: Open	

Connects To: Manhole

☐ Possible Illicit Connection